



Texas Department of Insurance State Fire Marshal's Office – Inspections Division

Mail Code 112-FM, 333 Guadalupe • P. O. Box 149104, Austin, Texas 78714-9104
512-305-7900 telephone • 512-305-7359 fax

April 18, 2011

Bayside Grill
#8 Kemah Waterfront- F
Kemah, Texas 77565
Jamie Lortie
281-334-9880

Inspection Number: RRO9575A
Date of Consultation: 4/5/2011
Galveston County

Authority: 417.008, Tex. Gov. Code and adopted rules 28 TAC 34.303

As a result of questions raised by concerned citizens and to assist the Kemah Emergency Services District, the State Fire Marshal's Office provided consultation services regarding minimum fire protection requirements for the above noted facility on April 5, 2011.

The City of Kemah is the Authority Having Jurisdiction, and currently enforces the *2003 Edition of the International Fire Code, (IFC) and 2009 Edition of NFPA 101, Life Safety Code*. The State Fire Marshal's Office has adopted, and currently enforces the *2009 Edition of NFPA 101, Life Safety Code*.

The State Fire Marshal's Office is only authorized by state statutes to enforce the requirements of *NFPA 101, Life Safety Code*; and is not permitted to enforce or regulate a fire code that is adopted by an incorporated city, or other government entity.

This consultation is intended to provide basic information regarding interpretation of minimum code requirements for features of fire protection for this building occupancy classification. You may wish to cross reference the *Life Safety Code with the IFC* for comparative value regarding minimum life safety standards.

The *2009 Edition of the National Fire Protection Association, 101, Life Safety Code*, is referenced for consultative findings in this report.

Bayside Grill is a single story existing assembly occupancy of wood frame construction with a wood exterior and composition shingle roof, located on an elevated foundation. Features of fire protection include fire sprinkler protection throughout, a fixed extinguishing hood system for kitchen appliances, portable fire extinguishers, illuminated exit signs and emergency lighting units.


A certificate of occupancy issued by the City of Kemah building permit department has established an occupant load of 57 for this building occupancy.

Protection Hazards:

Sprinklers located in the open ceiling space have been painted black and show signs of being loaded with dust and debris on the deflectors and frangible bulbs.

Any sprinkler shall be replaced that has signs of leakage; is painted, other than by the manufacturer, corroded or loaded with debris, or in the improper orientation.

This hazard was referred to the State Fire Marshal's Office- Licensing and Investigations Division for further investigation of the fire protection company that conducted inspections and maintenance of the system.

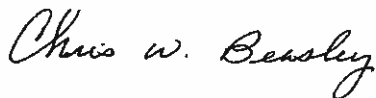

Chris W. Beasley, CFI
Deputy State Fire Marshal
State Fire Marshal's Office
Fire Safety Inspection Services

cc: Brent E. Hahn, Fire Chief/Fire Marshal
City of Kemah
Landry's Corporation